

Rally and Shift Spinner™ Bike Belt Tension Spring Replacement

Applies to

Model: Rally Spinner™ and Shift Spinner™ Belt Drive Bikes

Mfg. Date: Units prior to 03/15/2016

Issue/Symptoms

The belt tension spring makes metal to metal contact with the threads of the tension adjustment bolt. This may create clicking or squeaking noises as the belt tensioner moves during use.

Resolution

Replace the belt tension spring with a modified version that adds nylon bushings to hold the spring in position eliminating the possibility of metal to metal contact with the tension adjustment bolt.

Tools required

- 5 mm Hex Key
- 13 mm wrench
- Belt Tension Gauge (recommended Kent-Moore BT-33-73-F)

Parts required

QTY	Part Number	Description
1	PPP00000058205101*	CS KIT 58205-101, SPRING AND BUSHING REPAIR ON RALLY BELT DRIVEN

Note: * Kit includes required replacement parts and installation instructions.

Procedure

The installation instructions for this repair are included with the kit.

This service bulletin replaces the belt tension spring with a revised spring that adds bushings on either end of the spring.

ID	Description
1	Belt Tension Spring
2	Nylon Bushings

