

Rally and Shift Spinner™ Bike Rear Sprocket Finger Guard Replacement

Applies To

Models: Rally Spinner™ and Shift Spinner™ Chain Drive Bikes

Mfg. Date: Units prior to April 07, 2016

Issue/Symptoms

The chain finger guard length does not provide enough clearance for chain up/down travel. While riding you will hear scraping or clanging noises coming from the rear sprocket chain/belt guard cover.

Resolution

Replace current finger guard with a new extended length finger guard.

Tools required

- 5 mm Hex Key

Parts required

QTY	Part Number	Description
1	PPP00FT39063452000	REAR FINGERGUARD, ADDITIONAL CLEARANCE

Payment Schedule

\$25.00 per bike, plus travel, no bonus.


Procedure

Review entire procedure before starting.




Note: Refer to the *SBK800 Spinner Bike Line* service manual for replacement and adjustment procedures, see [SBK800 Spinner Bike Line Service Manual](#).

- 1 Remove the front and rear belt/chain guard covers.
- 2 Remove the rear sprocket finger guard **1** by removing the two fasteners using a 5 mm hex key. Keep fasteners for installation. Discard the finger guard.

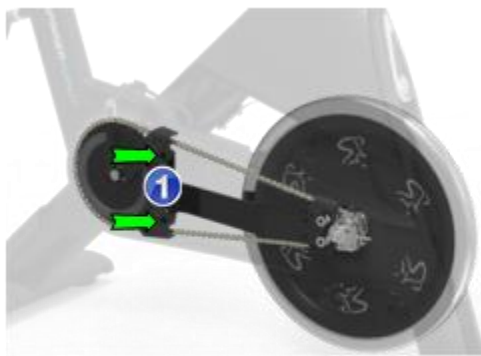

Chain Drive Spin Bike

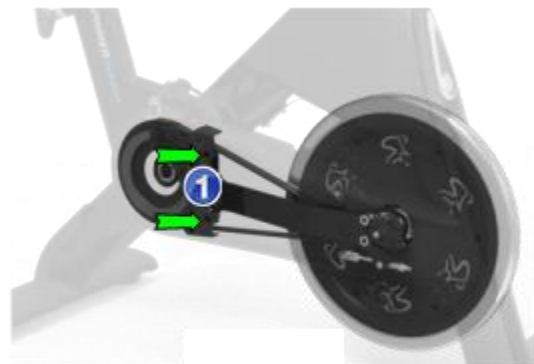

Belt Drive Spin Bike

- 3 Reinstall the new finger guard **1**, secure with two fasteners.
- 4 Replace belt/chain covers in reverse order.
- 5 Verify bike operation and return to service.