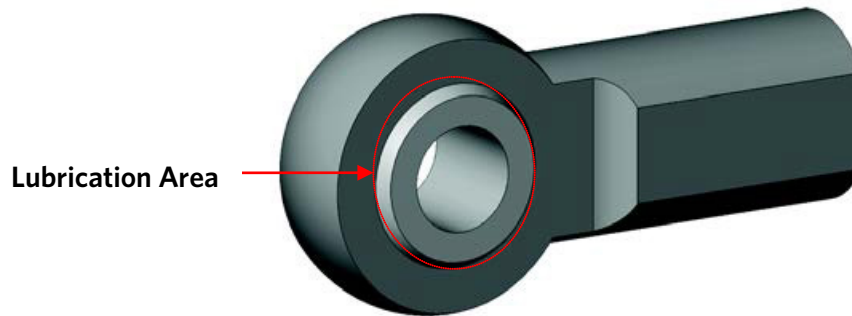


On occasion cable rod ends used on the Discovery Selectorized Strength Line and the C-Line may develop a squeaking noise. **See Diagram 1.** If the squeaking noise should occur, the weekly preventive maintenance procedures described in the Discovery Selectorized and C-Line Owners Manual should be performed.

Diagram 1 - Cable Rod End

Check cable rod ends to make sure the shoulder bolts are secure. If cable rod ends are noisy, lubricate them with a silicone spray lubricant or Lithium grease. Apply the lubricant onto the joint where the spherical portion is enclosed in the outer housing, as shown in **Diagram 1.** Wipe off any excess lubricant with a cloth.

***Important:** Do not use petroleum-based lubricants.*

If you have any questions regarding this service bulletin please contact **Precor Customer Support @ 1-800-786-8404.**